




Penetrant System Monitoring Panel Documentation

SN# 290395-036					
Crack Position	A	B	C	D	E
Photo of Defect					
Magnification Factor:	1 : 5.5				
Measured Size (Inch)	0.031	0.055	0.087	0.150	0.220
Specification (Inch)	0.015 - 0.031	0.046 - 0.062	0.075 - 0.093	0.125 - 0.171	0.180 - 0.250
Measured Size (mm)	0.79	1.40	2.21	3.81	5.59
Specification (mm)	0.38 - 0.79	1.17 - 1.57	1.91 - 2.36	3.18 - 4.34	4.57 - 6.35

Crack Depth	.0025" ± .0001"	63 µm ± 2.5µm
-------------	-----------------	---------------

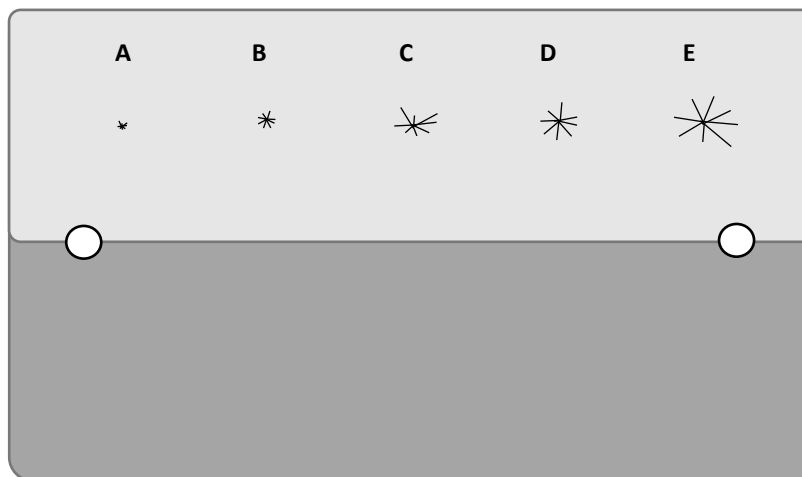

Measured with Keyence IM 8010
Calibration No. RM4133305

this panel does not contain hexavalent chromium